

YEAR
1992 and
Later

NEW

MODEL
ALL
except
SLX

NEW

VIN APPLICATION
ALL

BULLETIN NO.
93-015



Broken Seat Belt Tongue Stopper Button

(Supersedes 93-015, dated October 19, 1993)


PROBLEM

The seat belt tongue stopper button is broken, allowing the tongue to slide down to the floor.


CORRECTIVE ACTION

Install a new seat belt tongue stopper button listed under PARTS INFORMATION.


1. Slide the seat belt tongue up the seat belt past the tongue stopper button hole. Temporarily secure the seat belt tongue to the belt fabric with masking tape.
2. Insert the male section of the button through the hole in the belt fabric. Align and install the female section of the stopper to the male section.

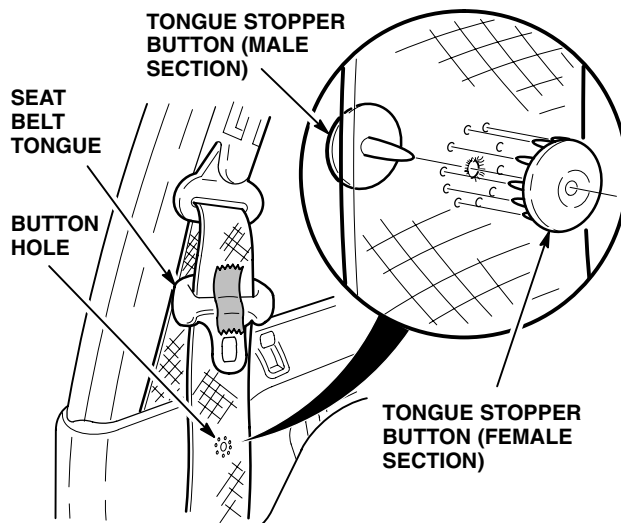

3. Preset the closed gap on a pair of vise-grip pliers to 4.5 mm.

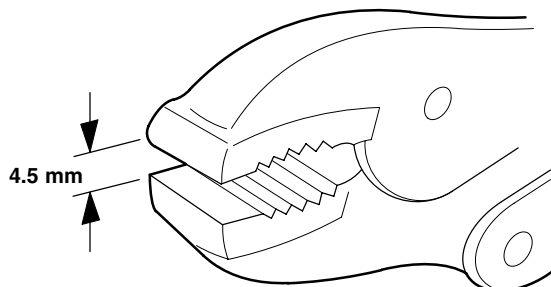

4. Place the flat portion of the jaws over the tongue stopper, and squeeze until the vise-grip jaws lock and deform the stopper shaft.

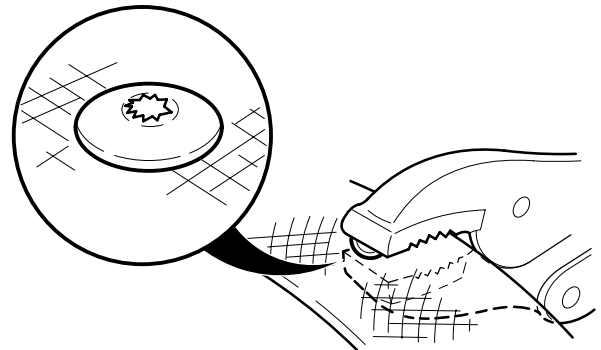

PARTS INFORMATION

Seat Belt Tongue Stopper:

Color	Part Number
Black	04814-SP0-305 ZA
Red	04814-SP0-305 ZB
Taupe	04814-SP0-305 ZC
Ivory	04814-SP0-305 ZD

WARRANTY CLAIM INFORMATION

Warranty Coverage:

Seat belts that fail to function properly during normal use are covered under warranty for the useful life of the car.

Warranty Does Not Cover:

- Malfunction due to abuse, alteration, accidental damage or damage resulting from a collision or misuse.
- Replacement of a properly functioning seat belt for cosmetic or comfort reasons.

Operation number: 854125
 Flat rate time: 0.2 hour
 (one or two sides)
 Failed P/N: 04814-SP0-A02ZA
 Defect code: L18
 Contention code: A02

NEW