



Transmission Mount Replacement

SYMPTOM

The customer may describe one or more of these symptoms:

Automatic Transmission:

- Harsh shifting
- Harsh engagement to reverse
- Harsh engagement to drive
- Engine/transmission vibration
- Excessive engine noise
- Clunk/noise when cornering
- Clunk/noise when accelerating or decelerating

Manual Transmission:

- Vehicle pops out of gear
- Difficult to engage gears
- Engine/transmission vibration
- Excessive engine noise
- Clunk/noise when cornering
- Clunk/noise when accelerating or decelerating

PROBABLE CAUSE

The transmission mount material is deteriorated or torn, reducing the isolation of vibration and shock.

CORRECTIVE ACTION

Replace the transmission mount as described in the appropriate section of the service manual. Use the improved part listed under PARTS INFORMATION.

Test drive the vehicle to determine whether the symptom has disappeared. If the symptom persists, continue troubleshooting.

PARTS INFORMATION

1991-92 Legend (*automatic transmission*)
Stopper, Transmission Mounting:
P/N 50805-SP0-305

1993-95 Legend (*automatic transmission*)
Stopper, Transmission Mounting:
P/N 50805-SP0-306

1991-95 Legend (*manual transmission*)
Stopper, Transmission Mounting:
P/N 50805-SP0-405

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Technical Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

Operation number: 112106

Flat rate time: 0.8 hour (includes road test)

Failed P/N: 50805-SP0-981 (A/T)
50805-SP0-010 (M/T)

Defect code: 018

Contention code: B99

Template ID: 96-024A (for 91-92 A/T)
96-024B (for 93-95 A/T)
96-024C (for 91-95 M/T)