

YEAR  
1992 - 93  
1991 - 93  
1991 - 93

MODEL  
VIGOR  
LEGEND  
NSX

VIN APPLICATION  
ALL

BULLETIN NO.  
92-039



## Rearview Mirror Reinstallation


### PROBLEM

The rearview mirror may be accidentally knocked off the windshield lug and some of the internal parts can be broken or lost.

### CORRECTIVE ACTION


Replace any missing or damaged parts (see PARTS INFORMATION), and reinstall the rearview mirror.

1. Remove the lock bolt from the mirror stay as described in the appropriate service manual.
2. Inspect the hook plate. If the hook plate is distorted, bend it to its original 90° position.

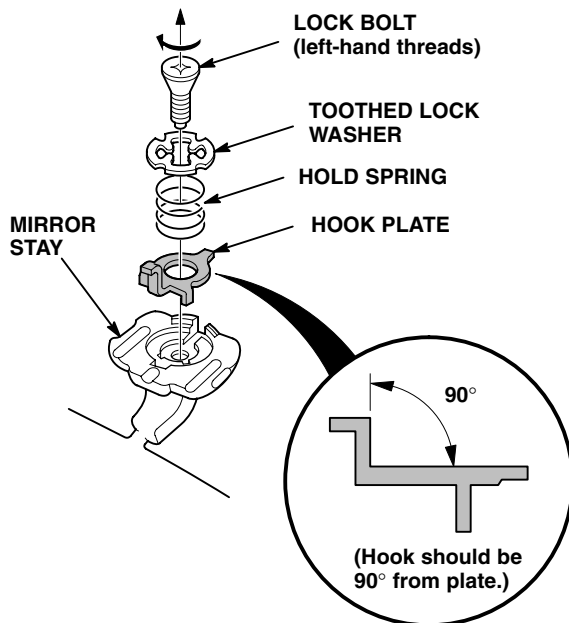

3. Inspect the lock bolt, the toothed washer, and the hold spring. Replace any parts that are missing, broken, or distorted (see PARTS INFORMATION).

4. Loosely install the hook plate, hold spring and the toothed washer to the mirror stay using the lock bolt. Make sure the hook plate is over the top of the toothed washer. Thread in the lock bolt until the toothed washer is approximately 5 mm from the mirror stay.

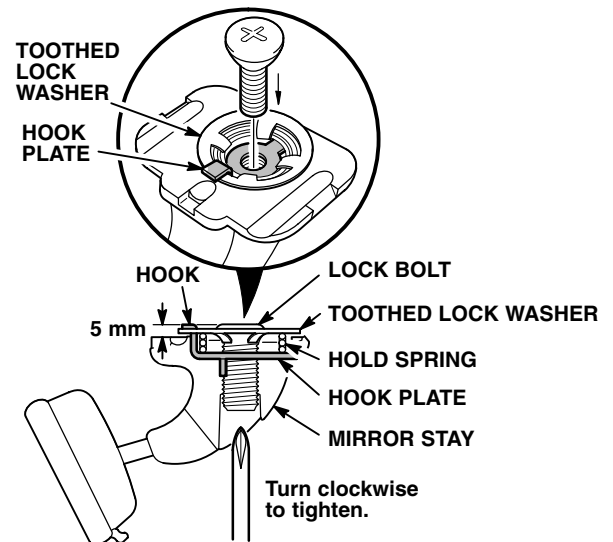

5. Install the mirror on the windshield lug, and torque the lock bolt to 2.0–3.0 N·m (20–30 kg·m, 14–22 lb·ft).

### PARTS INFORMATION

#### Vigor and NSX

Description	P/N
Lock bolt	76410-SL4-003
Toothed washer	76409-SL0-003
Hold spring	76409-SP0-A01

#### Legend

Description	P/N
Lock bolt	76410-SL4-003
Toothed washer	76410-SP0-003
Hold spring	76409-SP0-A01

**WARRANTY CLAIM INFORMATION**

**In warranty:** The normal warranty applies.

**Out of warranty:** Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager. You must request consideration, and get the DSM's decision, before starting work.

Operation number: 828155

Flat rate time: 0.2 hour

Failed P/N: P/N 76400-SP0-A01ZA

Defect code: 018

Contention code: B99