 


YEAR  
1991-92

MODEL  
LEGEND

VIN APPLICATION  
See VEHICLES AFFECTED

BULLETIN NO.  
92-013



## Remote Audio Volume Controls Inoperative or Cause Static

### SYMPTOMS

1. The remote volume control switches (up and down) are inoperative, but the preset station select (AUDIO) button is functional.  
OR
2. Static coming from the speakers when the remote volume control switches are used. This can occur during AM, FM, cassette or CD operation.

### PROBABLE CAUSE

Defective volume control motor inside the audio unit.

### VEHICLES AFFECTED

1991-92 Legend L Sedan  
1991-92 Legend LS Sedan  
1991-92 Legend LS Coupe

### CORRECTIVE ACTION

Diagnose the symptoms carefully. If necessary, replace the audio unit with the appropriate unit listed in PARTS INFORMATION.

#### SYMPTOM 1

Replace the audio unit ONLY if the remote volume control switches DO NOT work, and the preset station select (AUDIO) button does.

NOTE: If none of the remote controls work, refer to Service Bulletin 91-045, "Erratic Remote Audio Control Operation."

#### SYMPTOM 2

Replace the audio unit if static is heard from the speakers ONLY when the remote volume control switches are used.

There are other possible causes of static on Legend audio systems that are not related to the remote volume controls. Check for the following:

- On LS models with Bose System: If static occurs only on the AM band, and the remote volume control switches are NOT being used, refer to Service Bulletin 92-001, "Static on AM Band".
- If AM band reception is poor, or the system is picking up static from other sources, refer to Service Bulletin 91-053, "Poor Reception on AM Band".

### PARTS INFORMATION

1991-92 Legend LS Sedan & Coupe  
AM/FM/Cassette P/N 39100-SP0-A22RM

1991-92 Legend L Sedan  
AM/FM/Cassette P/N 39100-SP0-A12RM

### WARRANTY CLAIM INFORMATION

**In warranty:** The normal warranty applies.

**Out of warranty:** Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager. You must request consideration, and get the DSM's decision, before starting work.

Operation number: 010150

Flat rate time: 0.4 hour

Failed P/N: 1991-92 Legend LS Sedan & Coupe  
P/N 39100-SP0-A22

1991-92 Legend L Sedan  
P/N 39100-SP0-A12

Defect code: 064

Contention code: Use Audio Customer Contention Codes, page 9, Acura Flat Rate Manual.