

YEAR
1991

MODEL
LEGEND

VIN APPLICATION
4 door

BULLETIN NO.
91-034



Power Steering Pump Noise

VEHICLES AFFECTED

All 1991 Legend 4-doors through engine numbers:
 KA models: C32A1-1308706
 KL models: C32A1-1002094


SYMPTOM

Complaints of a hydraulic "swooshing" sound coming from the power steering pump, while turning when the power steering fluid is cold.

CORRECTIVE ACTION

Replace the power steering pump control valve.

1. Remove the power steering pump as described in the service manual.
2. Remove the control valve cap and remove the control valve. Verify the control valve size by looking for the identification letter (A or B) stamped on the valve as shown.

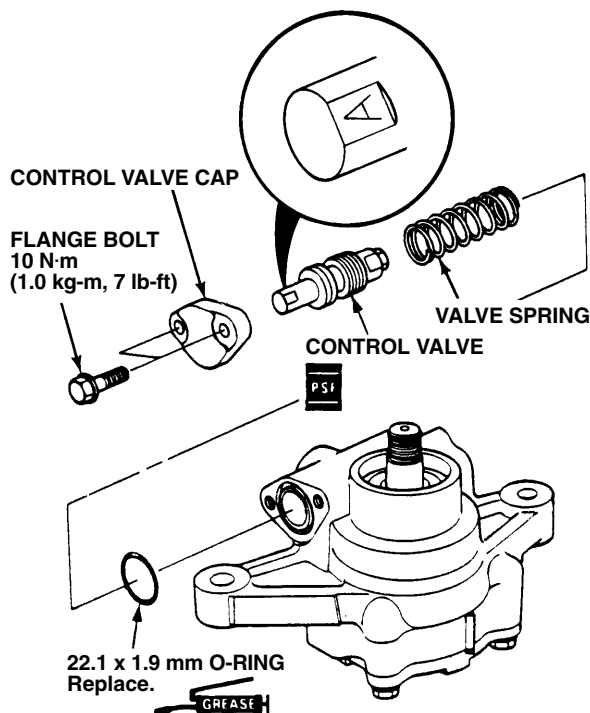

3. Replace the original control valve with a new control valve with the same identification letter. Refer to PARTS INFORMATION.
4. Replace the O-ring and install the new control valve. Reinstall the control valve cap and torque the bolts.
5. Reinstall the power steering pump as described in the service manual.

PARTS INFORMATION

Control Valve A: P/N 56170-PY3-020
 Control Valve B: P/N 56180-PY3-020
 O-ring 22.1 x 1.9: P/N 91346-PY3-000

WARRANTY INFORMATION

In warranty: The normal warranty applies.
Out-of-warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager. You must request consideration, and get the DSM's decision, before starting work.

Operation number: 512110
 Flat rate time: 1.0 hour (Includes bleeding & road test)
 Failed P/N: 56170-PY3-020
 Defect code: 042
 Contention code: B07