


YEAR
1992

MODEL
INTEGRA
LEGEND

VIN APPLICATION
See VEHICLES
AFFECTED

BULLETIN NO.
92-004

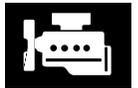

Product Update: Oil Pressure Switch

BACKGROUND

Oil pressure switches are supplied to Acura by two companies. A quantity of switches supplied by one company late in 1991 have a manufacturing defect that can cause them to seep oil at the joint between the plastic cap and the metal case.

VEHICLES AFFECTED

Integra 3-dr.: from VIN JH4DA9...NS007354 to JH4DA9...NS013528

Integra 4-dr.: from VIN JH4DB1...NS001883 to JH4DB1...NS003673

Legend Sedan: from VIN JH4KA7...NC006067 to JH4KA7...NC008424

Legend Coupe: from VIN JH4KA8...NC000628 to JH4KA8...NC001211

NOTE: Only vehicles within the above VIN ranges need inspection. Switches with green plastic ends on vehicles outside the ranges are not a problem.

CUSTOMER NOTIFICATION

Owners of affected vehicles will be contacted by mail and asked to take the car to a dealership for repair. The text of the customer letter is on the back of this service bulletin.

DEALER STOCK


Dealers should also inspect and repair any affected vehicles in their stock during PDI.

CORRECTIVE ACTION

Inspect the oil pressure switch to determine if it has a green plastic end or black plastic end. If it is green plastic, replace it with the switch listed under PARTS INFORMATION.


1. Integra only: raise the car on a hoist. The Legend oil pressure switch is mounted on the front of the engine and can be inspected without raising the car.

2. Locate the oil pressure switch. To inspect the plastic end to see what color it is, remove the wire and boot by pulling them straight off.

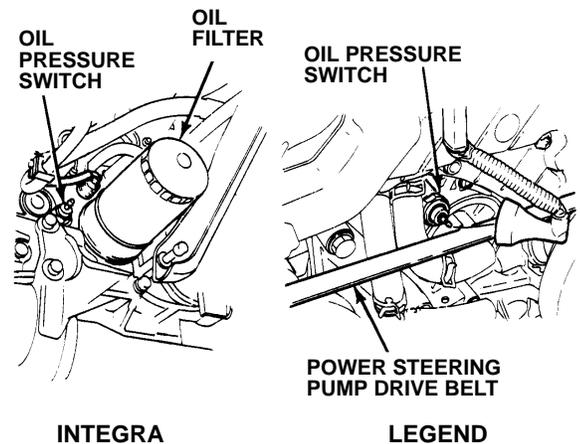

3. a) If the switch has a black plastic end, reconnect the wire and boot and go to step 4.
b) If the switch has a green plastic end, replace it with a new unit. Coat the threads with a 3 mm wide bead of Liquid Gasket (P/N 087180001) before installation. Torque the switch to 1.8 kgm (13 lbft).
4. Lower the hoist (Integra only). Check the engine oil level and add as needed.
5. Center punch a completion mark over the last digit in the VIN on the engine bulkhead.

Center punch completion mark.

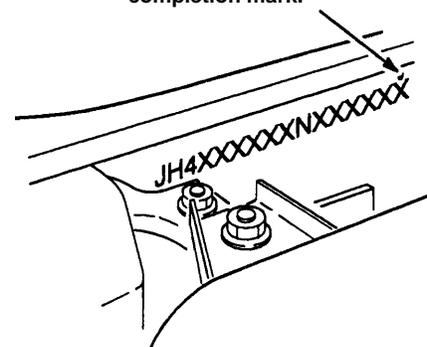

PARTS INFORMATION

Oil pressure switch: P/N 37240-PT0-013

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Technical Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

Integra

	Operation number	Flat rate time
Inspection	723555	0.3 hour
Inspect & Replace	723155	0.5 hour

Legend

	Operation number	Flat rate time
Inspection	723555	0.2 hour
Inspect & Replace	723155	0.4 hour

Failed P/N: 37240-PT0-004

Defect code: 265

Contention code: J53

January, 1992

Product Update: Oil Pressure Switch

Dear Acura Owner:

A few 1992 Legend and Integra automobiles were produced with an engine oil pressure switch that will seep oil. Our records indicate that your Acura may have one of these switches.

An updated oil pressure switch is available. Please call your dealer and make an appointment to have your Acura inspected. If he determines that the oil pressure switch is not up to specifications, he will replace it with an updated unit. *This update will be done free of charge.*

We apologize for any inconvenience this product update may cause you, however, our main concern is your continued satisfaction with your Acura automobile.

Respectfully,
Acura Automobile Division

AMERICAN HONDA MOTOR CO., INC.