

YEAR 1991 - 95 **NEW** MODEL LEGEND

VIN APPLICATION ALL **NEW**

BULLETIN NO. **91-045**



Erratic Remote Audio Control Operation

(Supersedes 91-045, dated September 29, 1992)

SYMPTOM

The radio may change stations if one of the remote volume controls on the steering wheel is pressed while turning the steering wheel. This may occur more often on cars equipped with an Acura cellular telephone.

PROBABLE CAUSE

Variation in grounding of the steering shaft as it rotates.

CORRECTIVE ACTION

Install the slip ring assembly listed under PARTS INFORMATION to improve grounding of the steering shaft. Refer to section 17 of the appropriate service manual.


1. Obtain the customer's audio system anti-theft code. Record the frequencies stored in the preset buttons.
2. Position the front wheels and steering wheel in the straight ahead position.
3. Disconnect the battery negative cable.
4. Remove the airbag and steering wheel as instructed in section 17 of the appropriate service manual. Be sure to follow all precautions for removal and handling of the airbag.
5. Remove the upper and lower column covers.

'91 - 93: Retract the steering column to its lowest position.


'94 - 95: Reconnect the tilt/telescope switch assembly in the lower steering column cover. Retract the steering column to its lowest position.

NEW

6. Remove three mounting screws, then remove the cable reel. Let the cable reel hang from the wire harness.

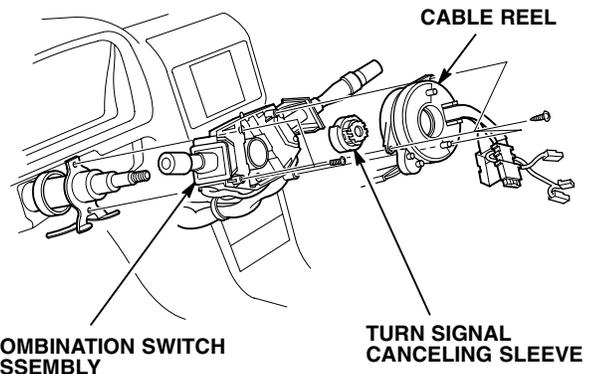

7. Remove the turn signal canceling sleeve.
8. Remove two mounting screws, then remove the combination switch assembly. For easier removal, angle it toward the passenger's side. Lay the assembly on the floor of the car, do not disconnect it from the wire harness.
9. Install the steering shaft slip ring as shown. The straight-cut edge of the slip ring should be on the bottom. Make sure the outer contacts fit tightly against the column tube and the inner contacts fit tightly against the steering shaft.

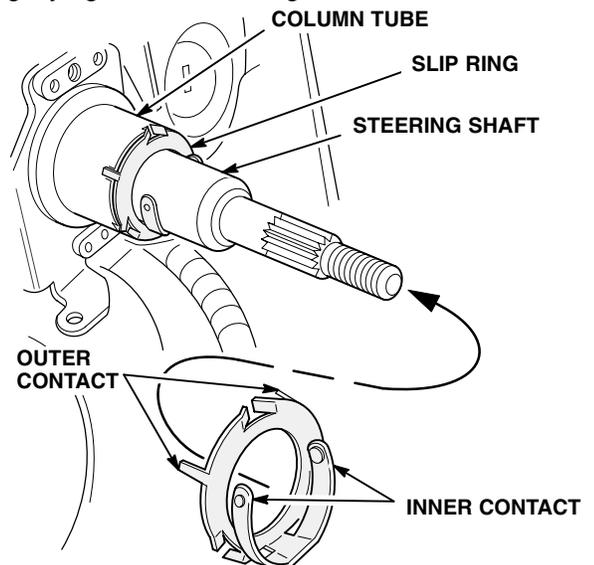

10. Install the combination switch assembly. Guide it in place carefully so you do not disturb the slip ring.
11. Install the canceling sleeve.
12. Install the cable reel assembly. Make sure the canceling sleeve and cable reel are engaged properly.
13. Install the upper and lower column covers.
14. *Center the cable reel* and install the steering wheel. Install the airbag.
15. Reconnect the battery negative cable. Enter the anti-theft code and set the preset buttons to the frequencies you recorded. Set the clock.

PARTS INFORMATION

Slip ring assembly: P/N 35257-SP0-315

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Technical Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

Operation number: 510112

Flat rate time: 0.8 hour

Failed P/N: 35257-SP0-305

Defect code: 064

Contention code: B99