

YEAR
1994

MODEL
LEGEND

VIN APPLICATION
See VEHICLES
AFFECTED

BULLETIN NO.
95-002



Product Update: Legend Security System

BACKGROUND

On some occasions, unlocking the driver's door with the key will not deactivate the security system. The alarm then sounds when the door unlocks.

VEHICLES AFFECTED

4-door: From VIN JH4KA7. . .RC001666
thru RC016172

Coupe: From VIN JH4KA8. . .RC000012
thru RC001780


CUSTOMER NOTIFICATION

Owners of affected vehicles will be contacted by mail and asked to take the car to a dealership for updating. The text of the customer letter is at the end of this service bulletin.


CORRECTIVE ACTION

Replace the door lock assembly in the driver's door.


1. Remove the trim plate and screws from the inner door handle.

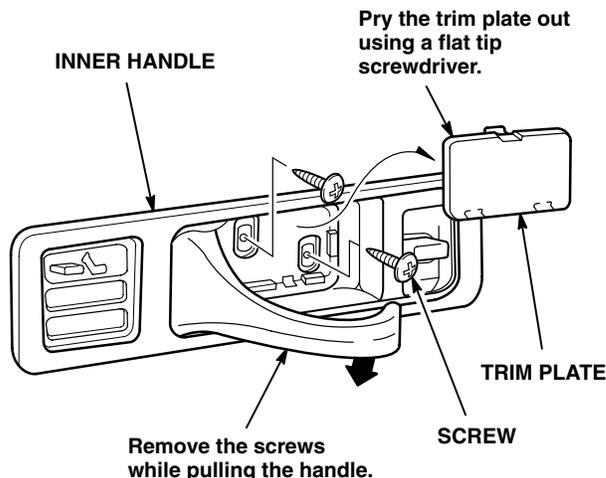


2. Remove the door panel.

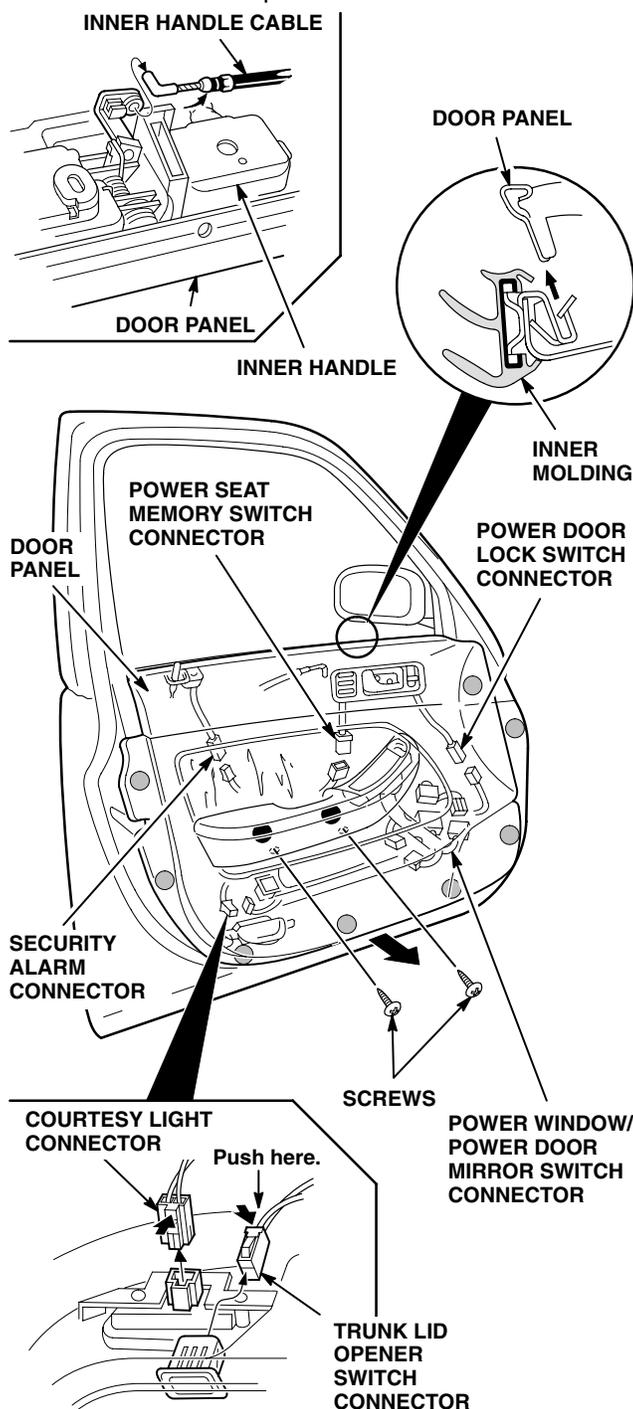


- Use a trim pad remover and a razor blade to remove the plastic cover.

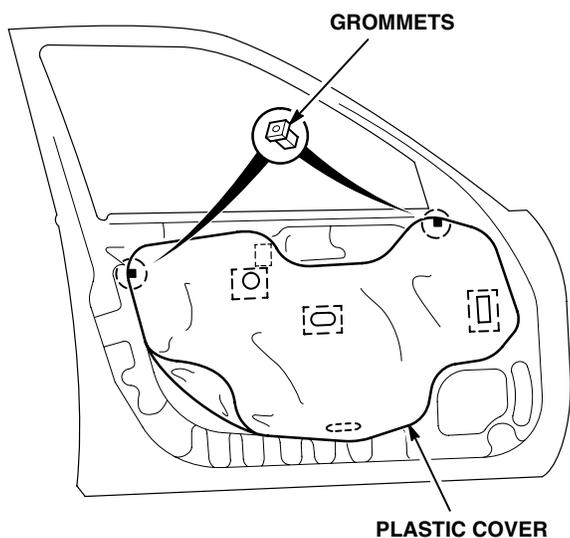


- Remove the inner molding.
- 4-door only:* Remove the stopper plate. Remove the mounting bolts, then slide the front channel forward.

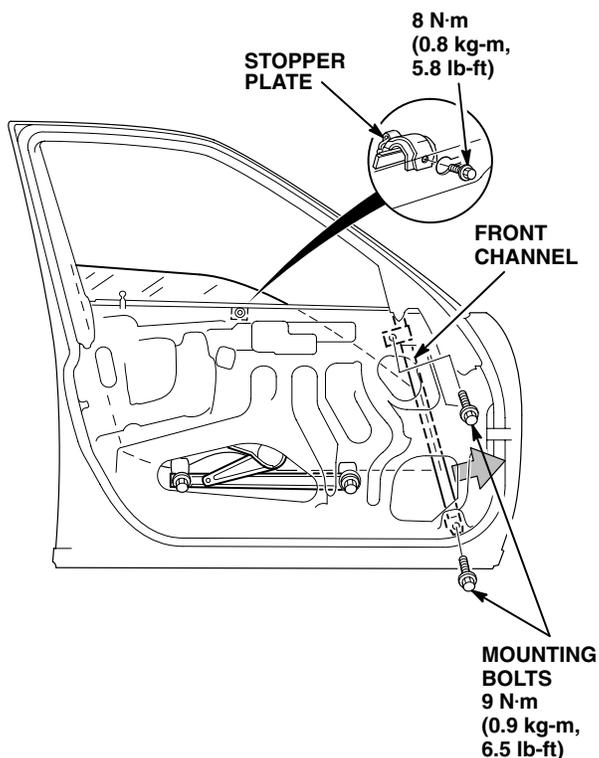


- Lower the window until you can see the glass mounting bolts. Loosen the bolts, slide the guide to the rear, and pull the glass out through the opening.

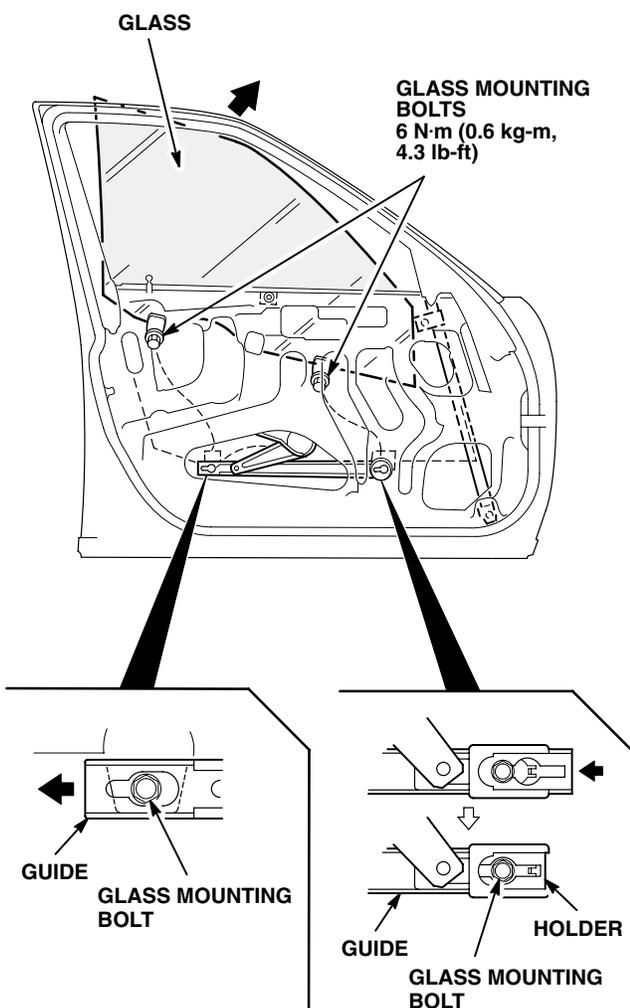


- Remove the glass run channel from the rear channel. Remove the mounting bolt, then remove the rear channel.

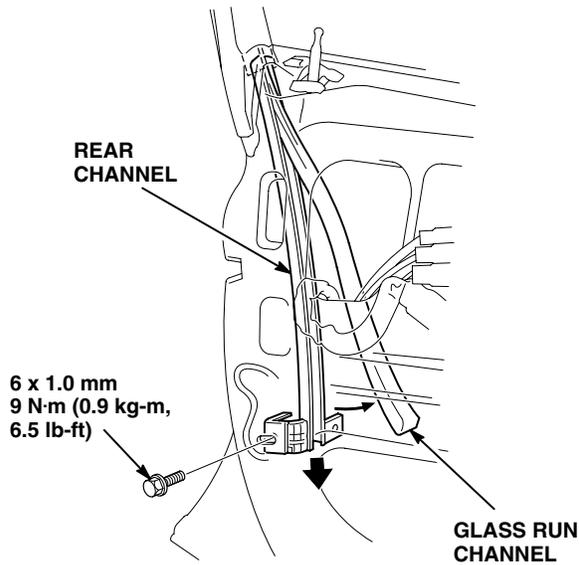

- Use a small flat tip screwdriver to pry the outer handle rod and cylinder rod out of their joints. Disconnect the electrical connectors for the lock assembly. Release the clip holding the wiring harness to the door.

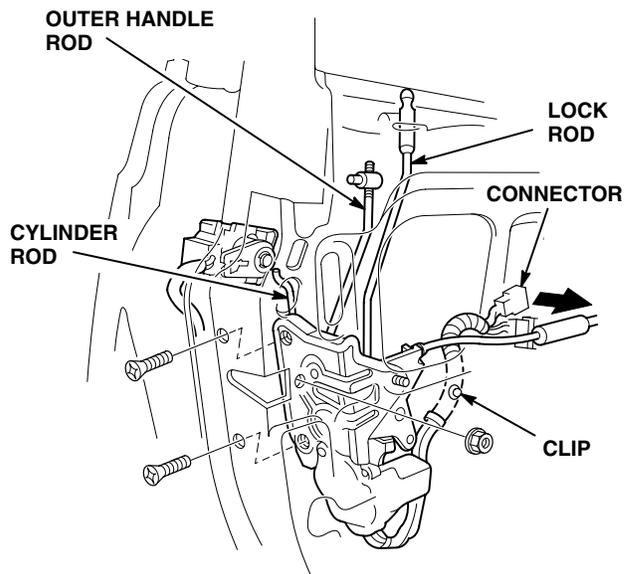


- Remove the two mounting screws and the mounting nut. Remove the lock assembly from the door.

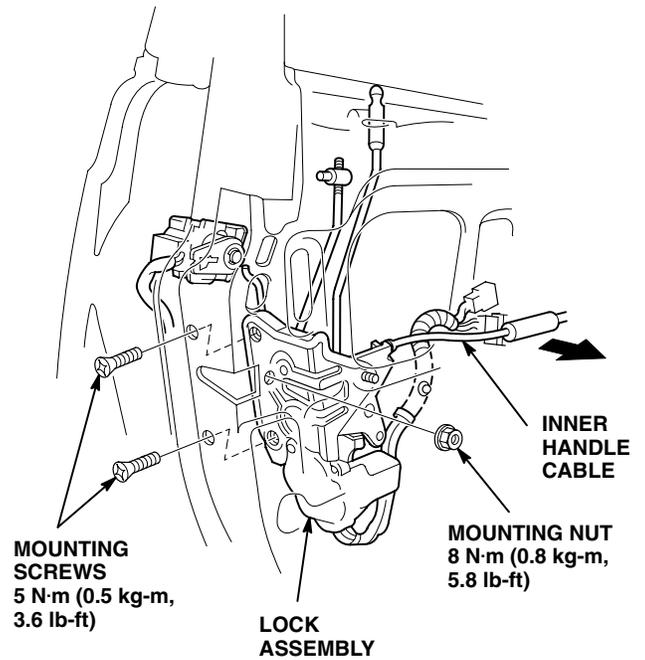

- Install the new lock assembly in the door. Adjust the length of the outer handle rod and reinstall it. Reinstall the cylinder rod, connect the electrical connectors, and clip the harness to the door.

- Reinstall all removed parts.

- Center-punch a completion mark above the first character of the engine compartment VIN.

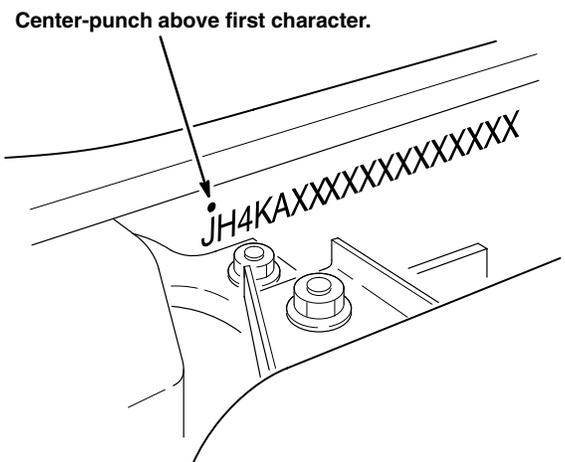

PARTS INFORMATION

Power door lock assembly, 4-door:
P/N 72150-SP0-A01

Power door lock assembly, Coupe:
P/N 72150-SP1-A01

WARRANTY CLAIM INFORMATION

Operation number: 748125 – Coupe
748126 – 4-door

Flat rate time: 0.8 hour

Failed P/N: 72150-SP0-A01

Defect code: 637

Contention code: J90

TEMPLATE ID	DESCRIPTION	FLAT RATE TIME
Coupe – J90A	748125 – Replace power door lock assembly	0.8 hour
Sedan – J90B	748126 – Replace power door lock assembly	0.8 hour

Example of Customer Letter

February 1995

Product Update: Legend Security System

Dear Legend Owner:

We are writing to notify you of a potential problem with your Legend.

What is the problem?

Normally, the security system is deactivated when the key is used to unlock the driver's door. However, an electrical switch in the driver's door lock mechanism may occasionally malfunction, causing the security system to remain on. As a result, the alarm sounds when the door unlocks. Turning the key to unlock a second time normally causes the electrical switch to make contact and cancel the alarm.

What should you do?

Call your local Acura dealer and make an appointment to have your car updated. They will install an improved driver's door lock mechanism. Parts are now available. *This work will be done free of charge.* You should have your car updated even if you have never experienced this problem.

What to do if our information is incorrect.

This notice was mailed to you according to the most current information we have available. If you no longer own a Legend, or the name and address information in this notice is incorrect, please fill out and return the enclosed *Information Change Card*. This will help us to update our records.

If you have questions.

If you are not sure how to contact an Acura dealer, or have questions about this notice, please call or write to:

Acura Customer Relations Department
1919 Torrance Boulevard
Torrance, CA 90501-2746
(800) 382-2238

We apologize for any inconvenience this product update may cause you; however, our main concern is the continued trouble-free enjoyment of your Acura Legend.

Sincerely,

AMERICAN HONDA MOTOR CO., INC.
Acura Automobile Division