

YEAR  
1991

MODEL  
LEGEND COUPE

VIN APPLICATION  
ALL

BULLETIN NO.  
91-044




## Replacement Of Rear Quarter Window Garnish Rubber

### SYMPTOM

Damaged rubber on the quarter window garnish.


### PROBABLE CAUSE

The window glass does not clear the quarter window garnish rubber.

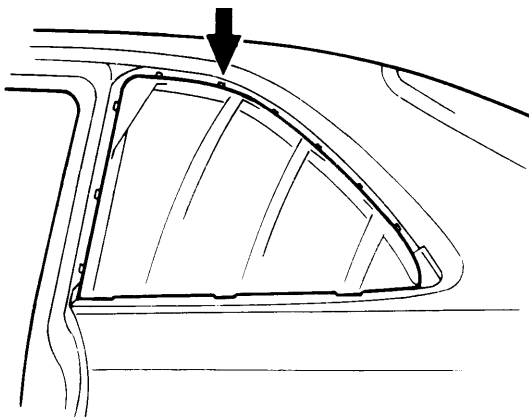


### CORRECTIVE ACTION


1. Remove the rear seat back, seat cushion and the quarter trim panel. Refer to section 20 of the Legend Coupe Service Manual, page 20-16, for detailed instructions.
2. Lift the lower edge of the vinyl seal to access the bottom regulator's adjuster.
3. Loosen the locknut. Turn the adjusting bolt counterclockwise while raising and lowering the glass.

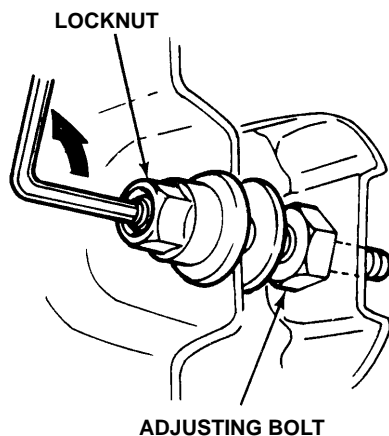

4. Adjust the top of the glass to just clear the garnish rubber.

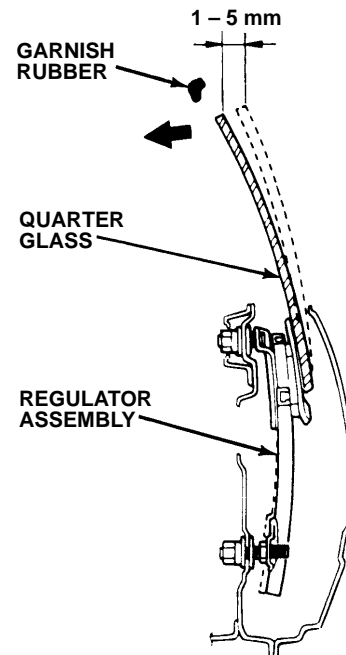

5. If the garnish rubber is loose, reattach it to the garnish with super-glue.

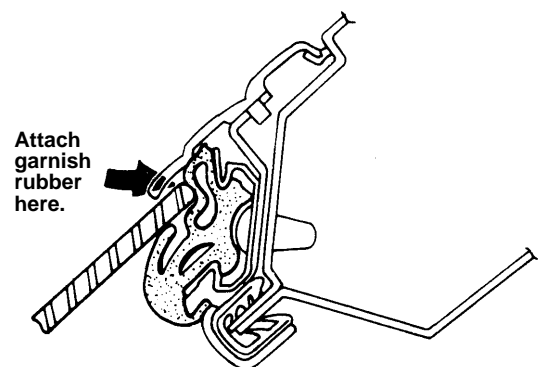

6. If the garnish rubber is deformed, remove it and the run channel from the body. Use 3M General Purpose Adhesive Cleaner (P/N 08984) to clean the garnish rubber attachment surface.
7. Install the replacement garnish rubber listed under PARTS INFORMATION. Add a little super-glue to the self adhesive. Make sure it doesn't get on the exposed surfaces of the garnish rubber.
8. Reinstall the run channel.
9. Check the clearance of the other quarter glass garnish rubber and adjust or repair as necessary.
10. Reinstall the vinyl seal, the trim panel, and the rear seat.

## PARTS INFORMATION

Rubber, garnish            P/N 73820-SP1-999

## WARRANTY CLAIM INFORMATION

**In warranty:** The normal warranty applies.

**Out-of-warranty:** Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager. You must request consideration, and get the DSM's decision, before starting work.

Operation number:    829133 – left side  
                                  830133 – right side

Flat rate time            0.7 (each side)

Failed P/N:              73820-SP1-013

Defect code:             004

Contention code:        B99